


(Iron stanchion was in joint & bricks were so broken by driving of this & other stumps through joint that could not see exactly what was what, to measure to see arrangement of laying of brick.

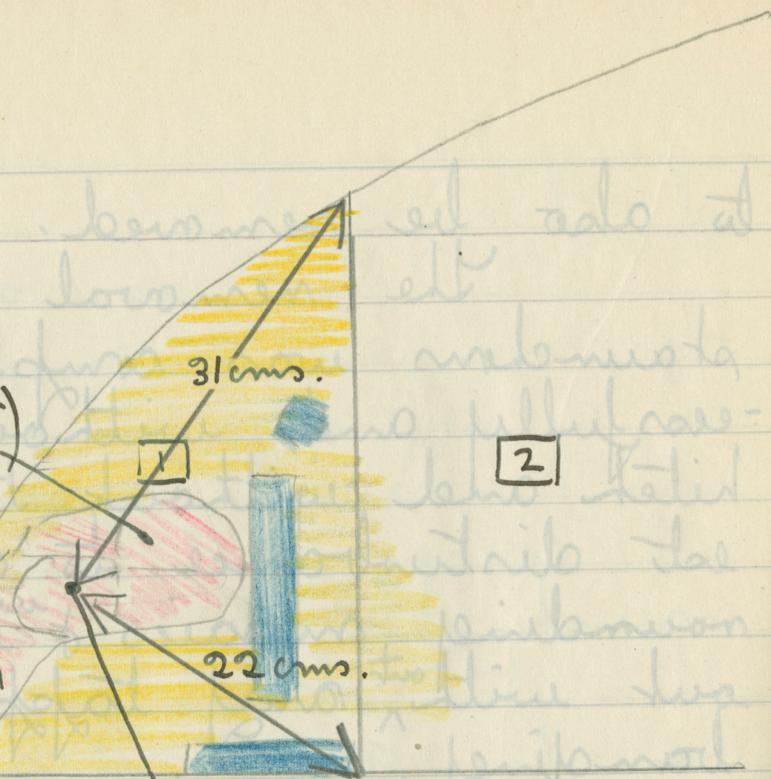

(Spot where iron stanchion was removed.)

July 20th.

Thursday.
Wednesday.

N. Tympanum Wall.

Recess No 5. (St. Soterios)


During the morning photography was carried on, movie and stills & little else was done.

In the afternoon the gaps in mosaics caused by iron and the area of missing mosaics around the iron were cleaned and back to brick and prepared

with Vinyl ready for
filling with our plaster.
During the filling
of this area also placed
a cramp here. Setails
of this cramp will be
found in "Cramp Chart."

Later in ~~the~~ the
day replaced the tessellae
which had been removed
for the cramps in sections
13 and 15. Tested both of
these cramps and found
they have done all that
was expected of them.
All movement is not quite
taken up in these areas
but it will only need

one or two more cramps
to make adhesion, in both
sections, back to brick.

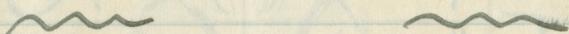

Today continued uncovering
here. At the end of the
day about completely uncovered
the whole of the in-
terior of the main, exposed
today were strong and set
in good condition.